

AD-A066 225

CIVIL ENGINEERING LAB (NAVY) PORT HUENEME CALIF  
1978 INSPECTION OF EXPERIMENTAL MARINE PILING AT PEARL HARBOR, --ETC(U)  
DEC 78 T ROE


F/G 13/10

UNCLASSIFIED

CEL-TN-1538

NL

1 OF 2  
AD  
A0 66225

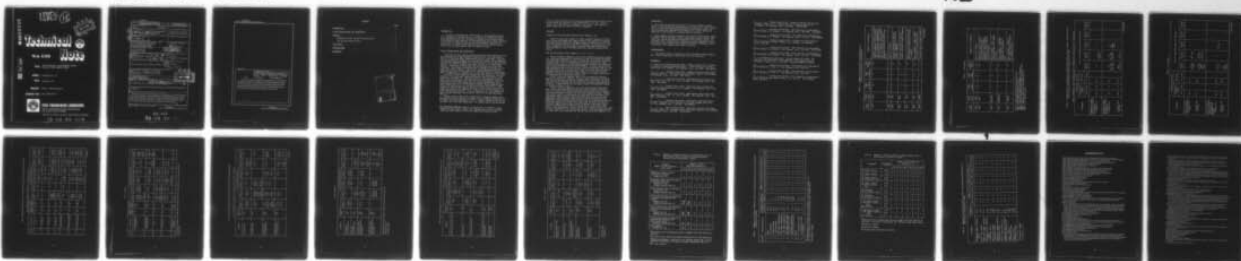

END  
X  
6--79  
DDC  
CONT

AD A066225

DDC FILE COPY

LEVEL II

(12)



# Technical



# Note

TN no. N-1538

**title:** 1978 INSPECTION OF EXPERIMENTAL MARINE  
PILING AT PEARL HARBOR, HAWAII

**author:** Thorndyke Roe, Jr.

**date:** December 1978

**sponsor:** Chief of Naval Material

**program nos:** DNL Z-R000-01-147



## CIVIL ENGINEERING LABORATORY

NAVAL CONSTRUCTION BATTALION CENTER  
Port Hueneme, California 93043

Approved for public release; distribution unlimited.

79 03 20 019

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER TN-1538	2. GOVT ACCESSION NO. DN244075	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) 1978 INSPECTION OF EXPERIMENTAL MARINE PILING AT PEARL HARBOR, HAWAII.		5. TYPE OF REPORT & PERIOD COVERED Final; Apr 1977 - May 1978
7. AUTHOR(s) Thorndyke/Roe, Jr		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS CIVIL ENGINEERING LABORATORY Naval Construction Battalion Center Port Hueneme, California 93043		8. CONTRACT OR GRANT NUMBER(s)
11. CONTROLLING OFFICE NAME AND ADDRESS Chief of Naval Material Washington, DC 20360		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS 61152N; DNL Z-R000-01-147
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office) Final rept. Apr 77- May 78		12. REPORT DATE December 1978
16. DISTRIBUTION STATEMENT (of this Report) Approved for public release; distribution unlimited.		13. NUMBER OF PAGES 24
17. DISTRIBUTION STATEMENT (of the abstract entered in Block 20, if different from Report) CEL-TN-1538		15. SECURITY CLASS. (of this report) Unclassified
18. SUPPLEMENTARY NOTES ZR000001		15a. DECLASSIFICATION/DOWNGRADING SCHEDULE
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Pile structures, marine borers, marine borer prevention, wood preservatives, biodeterioration, intertidal zone.		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) In 1978, a diver made the final inspection of the cooperative-, CEL-, and CEL/industry- treated piles at Pearl Harbor. The cooperative piles are performing satisfactorily, especially those with dual treatments. Satisfactory CEL- and CEL/industry-treatments were creosote which contained a specific toxic additive or additives and creosote-free treatments which were either a solution containing two toxic compounds, or a dual treatment.		

DD FORM 1 JAN 73 1473 EDITION OF 1 NOV 65 IS OBSOLETE

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE (When Data Entered)

394 114

79 03 20 019

DDC  
RECEIVED  
MAR 22 1979  
REGULATED  
C

elf

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)

Library Card

Civil Engineering Laboratory  
1978 INSPECTION OF EXPERIMENTAL MARINE PILING  
AT PEARL HARBOR, HAWAII (Final), by Thorndyke Roe, Jr.  
TN-1538 24 pp December 1978 Unclassified

1. Piles

2. Treated piles

I. DNL Z-R000-01-147

In 1978, a diver made the final inspection of the cooperative-, CEL-, and CEL/industry-treated piles at Pearl Harbor. The cooperative piles are performing satisfactorily, especially those with dual treatments. Satisfactory CEL- and CEL/industry-treatments were creosote which contained a specific toxic additive or additives and creosote-free treatments which were either a solution containing two toxic compounds, or a dual treatment.

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE(When Data Entered)



# CONTENTS

	Page
INTRODUCTION . . . . .	1
PILING INSTALLATIONS AND INSPECTIONS . . . . .	1
FINDINGS . . . . .	2
Cooperative Piles and CEL Creosoted Piles . . . . .	2
CEL and CEL/Industry Piles . . . . .	2
CONCLUSIONS . . . . .	3
ACKNOWLEDGMENT . . . . .	3
REFERENCES . . . . .	3

ACCESSION FOR	
N 13	File Section <input checked="" type="checkbox"/>
DDG	C. H. Section <input type="checkbox"/>
IN NO NO D	<input type="checkbox"/>
INSTRUCTIONS	
INSTRUCTIONS/AVAILABILITY CODES	
and/or SPECIAL	
A	

## INTRODUCTION

In order to determine the effectiveness of any proposed preservative treatment for wood piling, it is necessary to expose full-sized piles impregnated with that treatment in marine borer infested waters. To decrease the time required to obtain meaningful data without imposing any artificial conditions upon the evaluation method, exposures are carried out in tropical locations where marine borers and the rate of their attack are much greater than in temperate waters.

## PILING INSTALLATIONS AND INSPECTIONS

From 1963 to 1976, the Civil Engineering Laboratory (CEL) monitored two installations of experimentally treated piles. One installation (Ref 1) at Coco Solo Annex, Rodman Naval Station, Canal Zone, consisted of piles treated and supplied by the Cooperative Marine Piling Committee (an informal committee composed of representatives from the wood-treating industry, the Forest Products Laboratory, and the W. F. Clapp Laboratories). Monitoring of these piles was discontinued after the 1976 inspection. The second installation (Ref 2 through 6) at Waipio Peninsula, Pearl Harbor, Hawaii, consisted of Cooperative Marine Piling Committee piles plus four groups of CEL- and CEL/Industry-treated piles. Table 1 summarizes the original data on the piles driven at Pearl Harbor.

From the initial inspection through the 1974 inspection, the piles exposed at both sites were inspected visually from the surface of the water (Ref 7 through 14). One interruption in the exposure at Pearl Harbor occurred in August 1972 when 120 of the experimental piles were accidentally pulled and brought ashore by Harbor Cleanup Unit HCU-1. Those removed were 42 of the Cooperative Marine Piling Committee piles and the CEL piles driven in 1963 and the 78 CEL piles driven in 1965. Inspection revealed that many of these piles were either lost or were broken and could not be identified. Thus, only 51 of the original 120 piles removed were redriven: 4 of the 1963 piles (2 of the Cooperative Marine Piling Committee's and 2 CEL's), and 47 of the 1965 CEL piles (Ref 13).

Because of the difficulties encountered in trying to observe submerged pile surfaces, CEL let a contract to the Al Hanson Diving Service\* to inspect the piles underwater in 1975. Similar contracts were let for the 1976, 1977, and 1978 inspections. Mr. Hanson reports the percentage

---

\*Mr. Hanson has been the inspector of wood piles for the Port of Los Angeles for more than 25 years. Mrs. Hanson, who is both a licensed diver and diver tender, acts as his tender and records his data.

loss of cross-sectional area of each pile caused by borer attack as well as the extent and location of the attack (Ref 15, 16, 17). Splits, checks, and other defects or damage are also noted. The results of these inspections are shown in Tables 2 through 9.

## FINDINGS

### Cooperative Piles and CEL Creosoted Piles (Tables 2, 6)

After 14 years and 5 months of actual exposure, Douglas fir piles dual-treated with ammoniacal copper arsenite and creosote and southern pine piles dual-treated with chromated copper arsenate Type A and creosote had sustained attack in the 0% to 1% range. No other pile in this group, except for the cupro-nickel-jacketed creosoted southern pine pile, performed as well; creosoted piles had sustained from 2% to 5% attack.

### CEL and CEL/Industry Piles (Tables 3, 4, 5, 7, 8, 9)

After 14 years of exposure, five of six southern pine piles treated with a moderate retention of creosote (17.4 pcf) containing 2% tributyltin oxide and 2% dieldrin were not attacked and the sixth has sustained only 2% attack. Four of six Douglas fir piles treated with a high retention (28.6 pcf) of creosote containing 5% chlordane were unattacked and two had sustained 1% to 3% attack; Douglas fir piles treated with high retentions (28.5 and 26.3 pcf) of creosote containing 2.5% or 1.25% chlordane had attack in the 0% to 3% range, except for one pile which sustained 4% attack in an area where a split or crack had occurred. Douglas fir piles treated with a high retention of creosote (32.9 pcf) had sustained 2% to 5% attack (Tables 3, 7).

After 13 years of exposure, most of the creosote-free treated Douglas fir piles were attacked. However, those treated with 5% chlordane and 2% tributyltin oxide had sustained 0% to 2% attack, and those treated with 5% chlordane and 1% tributyltin oxide had sustained 0% to 3% attack. Piles treated with 4% copper oxinate had sustained from 0% to 5% attack (Tables 4, 8).

After 12 years of exposure, one of six piles treated with basic zinc sulfate was unattacked, and five had sustained 2% to 3% attack. Five of six piles dual-treated with basic zinc sulfate and tributyltin oxide had sustained no attack, and the sixth showed 1% attack. Ammoniacal copper arsenite treated piles had sustained 1% to 4% attack, and ammoniacal copper arsenite-tributyltin oxide dual-treated piles had sustained no attack (three piles) and 1% to 3% attack (three piles). Ammoniacal copper arsenite-70/30 creosote-coal tar solution dual-treated piles had sustained no attack (four piles) and 1% attack (two piles). Chromated copper arsenate Type B plus tributyltin oxide dual-treated piles had sustained no attack (two piles) and 1% to 5% attack (four piles). The performance of piles treated with a high retention (31.7 pcf) of 70/30 creosote-coal tar solution was spotty: two were unattacked and the other four piles sustained 1%, 3%, 4%, and 15% attack (Tables 5, 9).



## CONCLUSIONS

1. After exposure periods of from 12 to 14 years 5 months in Pearl Harbor, piles treated with high retentions of creosote or 70/30 creosote-coal tar solution showed good resistance to marine borer attack, but this resistance was improved by the addition of a toxic additive or additives to the creosote or creosote-coal tar solution.
2. After exposure periods of from 12 to 13 years, creosote-free single treatments such as 4% copper oxinate, ammoniacal copper arsenite, and basic zinc sulfate showed good resistance to marine borer attack, but treatment with a solution which contained two toxic compounds or treatment with a water soluble toxic compound followed by treatment with an oil-soluble toxic compound gave better resistance.

## ACKNOWLEDGMENT

The author wishes to thank Mr. D. Kim, Maintenance Control Department, Public Works Center, Pearl Harbor, for his assistance.

## REFERENCES

1. Naval Civil Engineering Laboratory. Technical Note N-473: Cooperative marine piling investigation, Phase 1 - Pile driving at Coco Solo, Canal Zone, by H. Hochman. Port Hueneme, Calif., Apr 1963. (AD 405914)
2. \_\_\_\_\_. Technical Note N-503: Cooperative marine piling investigation: Phase 2 - Pile driving at Pearl Harbor, Hawaii, by H. Hochman. Port Hueneme, Calif., Jul 1963. (AD 417175)
3. \_\_\_\_\_. Technical Note N-672: Experimental wood piling treatments FY-64, by T. Roe, Jr., and H. Hochman. Port Hueneme, Calif., Dec 1964. (AD 456491)
4. \_\_\_\_\_. Technical Note N-677: Driving of piles treated with creosote containing additives, by H. Hochman. Port Hueneme, Calif., Dec 1964. (AD 458071)
5. \_\_\_\_\_. Technical Note N-736: Experimental wood piling treatments FY-65, by T. Roe, Jr., and H. Hochman. Port Hueneme, Calif., Aug 1965. (AD 468687)
6. \_\_\_\_\_. Technical Note N-898: Experimental wood preservative systems: Treatment, FY 66; Driving, FY 67, by H. Hochman and T. Roe, Jr. Port Hueneme, Calif., Jun 1967. (AD 816825L)
7. \_\_\_\_\_. Technical Note N-879: Cooperative marine piling investigation - Phase III - Inspection after four years exposure, by H. Hochman. Port Hueneme, Calif., Mar 1967. (AD 811337L)



8. \_\_\_\_\_. Technical Note N-957: Cooperative marine piling investigation - Phase III. A - Inspection after five years exposure, by H. Hochman. Port Hueneme, Calif., Apr 1968. (AD 831178L)
9. \_\_\_\_\_. Technical Note N-1048: 1969 inspection of experimental marine piling, by H. Hochman. Port Hueneme, Calif., Sep 1969. (AD 859356)
10. \_\_\_\_\_. Technical Note N-1116: 1970 inspection of experimental marine piling, by H. Hochman. Port Hueneme, Calif., Jul 1970. (AD 873228L)
11. \_\_\_\_\_. Technical Report R-757: Evaluation of pile preservatives at Coco Solo and Pearl Harbor, by H. Hochman. Port Hueneme, Calif., Feb 1972.
12. \_\_\_\_\_. Technical Note N-1253: 1972 inspection of experimental marine piling, by H. Hochman. Port Hueneme, Calif., Dec 1972. (AD 753194)
13. \_\_\_\_\_. Technical Note N-1298: 1973 inspection of experimental marine piling, by H. Hochman. Port Hueneme, Calif., Jul 1973. (AD 767636)
14. Civil Engineering Laboratory. Contract Report CR 74.009: The inspection and evaluation of experimentally treated wood piling, by H. Hochman. Oxnard, Calif., Jun 1974. (Contract N68305-74-C-0010)
15. \_\_\_\_\_. Technical Note N-1418: 1975 inspection of experimental marine piling, by T. Roe, Jr. Port Hueneme, Calif., Dec 1975.
16. \_\_\_\_\_. Technical Note N-1466: 1976 inspection of experimental marine piling, by T. Roe, Jr. Port Hueneme, Calif., Dec 1976.
17. \_\_\_\_\_. Technical Note N-1505: 1977 inspection of experimental marine piling at Pearl Harbor, Hawaii, by T. Roe, Jr. Port Hueneme, Calif., Nov 1977.

Table 1. Summary of Initial Data on Experimentally Treated Piles Driven at Pearl Harbor

Year Driven	Source of Piles <sup>a</sup>	Number of Treatments	Piles Per Treatment	Total Number of Piles	Summary of Treatments
1963	Coop	10	6	60	Inorganic salt followed by creosote (dual treatment); 70-30 creosote-coal tar solution; phenylmercuric oleate dissolved in 70-30 creosote-coal tar solution; 70-30 creosote-coal tar solution followed by sheathing with 90:10 cupro-nickel alloy
1963	CEL	1	6	6	Type III creosote
1964	CEL	9	6	54	Creosote solutions of specific organic compounds and/or metal organic compounds
1964	OWPC	1 1 1	4 5 6	15	Creosote solutions of specific organic and metal organic compounds
1965	CEL	13	6	78	Solutions of specific organic and metal organic compounds in xylene or creosote
1966	CEL	2	6	12	Dual treatment: copper sulfate followed by tributyltin oxide
1966	BCCWP	1	6	6	Chromated copper arsenate (Type B)

(continued)

Table 1. Continued

Year Driven	Source of Piles <sup>a</sup>	Number of Treatments	Piles Per Treatment	Total Number of Piles	Summary of Treatments
1966	AZLS	3	6	6	Basic zinc sulfate
1966	AZLS	3	6	18	Ammoniacal copper arsenite; 70-30 creosote-coal tar solution; dual treatment: ammoniacal copper arsenite followed by 70-30 creosote-coal tar solution
1966	AZLS/CEL	1	6	6	Dual treatment: basic zinc sulfate followed by tributyltin oxide
1966	BCCWP/CEL	1	6	6	Dual treatment: chromated copper arsenate (Type B) followed by tributyltin oxide
1966	JHB/CEL	1	6	6	Dual treatment: ammoniacal copper arsenite followed by tributyltin oxide

<sup>a</sup>Coop = Cooperative Marine Piling Committee.

CEL = Civil Engineering Laboratory.

OWPC = Osmose Wood Preserving Company of America.

BCCWP = British Columbia Clean Wood Preservers, Ltd.

AZLS = American Zinc, Lead, and Smelting Co.

JHB = J. H. Baxter and Co.



Table 2. Results of 1978 Inspection of Cooperative Piles at Pearl Harbor, Plus One Set of Piles Treated With Creosote by CEL (installed in 1963)

[Mart = Martesia; Lim = Limnoria; Ter = Teredo; ML = Mud Line; TA = Tide Area]

Treatment	Retentions (lb/ft <sup>3</sup> )				Loss of Cross-Sectional Area (%) for --				
	Cooperative Assay		CEL Assay		Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5
	Oil	Salt	Oil	Salt					
Ammoniacal copper arsenite followed by creosote Douglas Fir	16.2	6.9	9.7	-	0	1: TA, dead Mart	0		
Chromated copper arsenate followed by creosote Douglas Fir	8.4	2.7	2.7	-	12: TA to ML, Lim, Mart	55: TA, Mart, Lim, Ter	2: ML, dormant Mart		
Southern Yellow Pine	23.2	2.7	17.3	-	Pile missing	1: TA, Lim	0		

(continued)



Table 2. Continued

Treatment	Retentions (lb/ft <sup>3</sup> )				Loss of Cross-Sectional Area (%) for --				
	Cooperative Assay		CEL Assay						
	Oil	Salt	Oil	Salt	Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5
70-30 creosote-coal tar solution Douglas Fir	15.3	-	11.1	-	1: TA, Mart holes	7: ML, Lim	0		
Southern Yel-low Pine	17.7	-	13.5	-	15: TA, Lim, large Mart holes	2: TA, Lim 10: ML, Lim			
70-30 creosote-coal tar solution containing 1% phenylmercuric oleate <sup>a</sup> Douglas Fir	20.7	-	18.5	-	13: TA, Lim	0	1: TA, Lim		
Southern Yel-low Pine	24.1	-	18.5	-	3: TA, etching, Lim				

(continued)

Table 2. Continued

Treatment	Retentions (lb/ft <sup>3</sup> )				Loss of Cross-Sectional Area (%) for --				
	Cooperative Assay		CEL Assay		Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5
	Oil	Salt	Oil	Salt					
70-30 creosote-coal tar solution containing 5% phenylmercuric oleate <sup>a</sup> Douglas Fir	13.0	-	10.0	-	2: TA attack dormant				
	27.5	-	22.1	-	12: TA to ML, Lim 3: ML, etching, Lim				
70-30 creosote-coal tar solution followed by sheathing with cupro-nickel alloy Southern Yel-low Pine	-	-	-	-	0				

(continued)

Table 2. Continued

Treatment	Retentions (lb/ft <sup>3</sup> )			Loss of Cross-Sectional Area (%) for --				
	Cooperative Assay		CEL Assay	Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5
	Oil	Salt	Oil Salt					
CEL creosote Douglas Fir	-	-	17.2	-	2: TA, Lim	5: TA, Lim, Mart holes	3: TA, etching, Lim	4: TA, Lim, Mart 2: ML, Lim, Mart

<sup>a</sup> Nominal percentages. Analyses of core borings showed that the wood absorbed considerably less than the nominal percentage. No individual retention figures were reported (Ref. 1).

Table 3. Results of 1978 Inspection of CEL- and Industry-Treated Piles at Pearl Harbor (installed in 1964)

[Lim = Limnoria; Mart = Martesia; Ter = Teredo; TA = Tide Area; ML = Mud Line]

Group <sup>a</sup>	Creosote Additive	Creosote Retention (lb/ft <sup>3</sup> )	Additive Retention (lb/ft <sup>3</sup> )	Loss of Cross-Sectional Area (%) for -					
				Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5	Piling No. 6
1	None	32.9	0.00	3: TA, Lim	2: TA, Lim	2: TA, etching, Lim	5: TA, Lim 1: ML, Lim	5: TA, Lim, few Mart holes	3: TA hole, Lim, not active
2	5% chlordane	28.6	1.4	0	0	2: TA, Lim 0: ML	1: TA, etching	0	0
3	2.5% chlordane	28.5	0.7	1: Lim slight etching, no live Mart	0	3: TA, Lim	3: TA, very small Mart holes	1: TA, very slight etching, Lim	1: TA, slight etching, Lim
4	1.25% chlordane	26.3	0.3	1: TA, etching, Lim	0	0	2: high TA, Lim	1: Mart, dead	4: 16 in. crack or split, Lim
5	30% copper naphthenate	8.3	0.27 <sup>b</sup>	2: TA, Lim	5: TA, Lim	3: TA, Lim, few Mart	7: TA to ML, Lim, Mart	5: TA, tapers to 3: ML, Lim, Mart	1: etching, Lim
6	15% copper naphthenate	9.4	0.15 <sup>b</sup>	8: TA, very small Mart holes	0	42: TA, Lim, Mart 6: ML, Lim	3: TA, Lim, few very small Mart holes	18: TA, Lim, few Mart	92: TA, tapers to 6: ML, Lim, Mart
7	7.5% copper naphthenate	10.9	0.09 <sup>b</sup>	97: TA, Lim, some Mart	0	73: 18 in. TA, Lim 4: ML, Lim	3: TA, etching, Lim	4: TA, Lim 2: ML, Lim	3-4: TA, Lim, few Mart holes

(continued)



Table 3. Continued

Group <sup>a</sup>	Creosote Additive	Creosote Retention (lb/ft <sup>3</sup> )	Additive Retention (lb/ft <sup>3</sup> )	Loss of Cross-Sectional Area (%) for -					
				Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5	Piling No. 6
8	14% copper naphthenate 1% tributyltin oxide	14.8	0.23 <sup>b</sup> 0.15	78: TA, 12 in. hole, pile split, Lim, Mart 6-4: -12 in. to ML	8: TA, Lim, some small Mart holes	2: TA, Lim, dead Mart	28: TA, tapers to 2: ML, Lim	94: TA 1: ML, Lim, Ter	69: TA, Lim, some Mart 3-4: ML, Lim, some Mart
9	7% copper naphthenate 0.5% tributyltin oxide	8.6	0.07 <sup>b</sup> 0.08	1: TA, etching, Lim	8: TA, Lim	1: TA, etching, Lim	7: TA, Lim, few Mart holes	77: TA 2: ML, Lim, some Mart	28: TA, tapers to 4: ML, Lim, Mart
10	None	18.6	0.00	33: TA, tapers to 14: ML, Lim, some Mart	29: TA, tapers to 4: ML, Lim, few Mart	77: TA, Lim 70: ML, Lim	30: TA to ML, Lim, very few Mart		
11	2% tributyltin oxide	13.9	0.28	18: TA, tapers to 3: ML, Lim	63: TA, Lim 4: ML, Lim	28: TA, Lim, few dead Mart 7: ML, Lim	94: TA, tapers to 6: ML, Lim	65: TA, Lim 4: ML, Lim	
12	2% tributyltin oxide 2% dieldrin	17.4	0.35 0.35	2: TA, Lim	0	0	0	0	0

<sup>a</sup> Treatment groups 1 through 9 had six Douglas fir piles each; groups 10, 11, and 12 had, respectively, four, five, and six pine piles each.<sup>b</sup> As metallic copper.

Table 4. Results of 1978 Inspection of CEL-Treated Piles at Pearl Harbor (installed in 1965)<sup>a</sup>

[Lim = Limnoria; Mart = Martesia; Ter = Teredo; TA = Tide Area; ML = Mud Line]

Treatment <sup>b</sup>	Retention (lb/ft <sup>3</sup> )	Loss of Cross-Sectional Area (%) for —					
		Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5	Piling No. 6
4% copper oxinate	0.87 <sup>c</sup>	4: TA halfway to ML, Lim	1: TA, etching, Lim	1: TA, Lim	5: TA, Mart, Lim	3: flat spot in TA, Lim, Mart	0
2% copper oxinate	0.49 <sup>c</sup>	2: TA, etching, Lim	4: piles split in TA, piece missing, attack in damaged area	20: TA, Lim, Mart, Ter 5: ML, Lim, Mart, Ter	0	4: TA, Lim	2: TA, Lim
2% copper oxinate 2% tributyltin oxide	0.25 <sup>c</sup> 0.25	10: TA, Ter, Mart, Lim 20: ML, Ter, Mart, Lim	10: TA, Mart, Lim 12: ML, Mart, Lim	5: TA, Lim 3: ML, Lim	4: TA, Mart, Lim 4: ML, Lim	7: TA, Lim	6: TA to ML, Mart, Lim
3% copper oxinate 1% Victoria green base	0.69 <sup>c</sup> 0.26	3: TA, Lim 2: ML, Lim	5: TA, Lim, Mart		2: ML, Lim	1: TA, Mart, Lim 2: ML, Mart, Lim	6: Lim, very few Mart 2: ML, Lim

(continued)

Table 4. Continued

Treatment <sup>b</sup>	Retention (lb/ft <sup>3</sup> )	Loss of Cross-Sectional Area (%) for -					
		Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5	Piling No. 6
5% chlordane 1% tributyltin oxide	1.3 0.27	2: TA, etching, Lim	0	1: TA, dormant Mart	3: 3 ft above ML, Lim	0	0
5% chlordane 2% tributyltin oxide	1.5 0.62	0	1: TA, dead Mart	0	0	2: TA, etching, Lim	0
1.5% copper oxinate 0.5% Victoria green base 50% creosote	0.27 <sup>c</sup> 0.09 9.2	6: ML, Lim	12: TA to ML, Mart, Lim, Ter	5: ML, Lim	5: TA to ML, Mart, Lim	7: TA, Mart, Lim 10: ML, Mart, Lim	8: TA, Mart, Lim 28: Lim, Mart
0.75% copper oxinate 0.25% Victoria green base 75% creosote	0.25 <sup>c</sup> 0.08 24.7	0	6: pile split in TA, attack inside split	3: TA to ML, small areas of attack	0	6: TA to 5: ML, Lim, Mart	9: TA, Mart, Lim 4: ML, Mart, Lim

<sup>a</sup>These piles were accidentally pulled in August 1972 and redriven in May 1973.<sup>b</sup>Solutions in xylene.<sup>c</sup>As metallic copper.



Table 5. Results of 1978 Inspection of CEL- and Industry-Treated Piles at Pearl Harbor (installed in 1966)

Treatment	Retention (lb/ft <sup>3</sup> )	Loss of Cross-Sectional Area (%) for					
		Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5	Piling No. 6
Chromated copper arsenate, Type B	0.50	100: TA, ML	100: top of pile missing 70: ML, Lim	6: TA, Mart, Lim	100: pile missing	100: TA, Ter, Mart, Lim 96: ML, Ter, Mart, Lim	3: TA, Mart 1: ML, Mart
Basic zinc sulfate	2.77 <sup>b</sup>	2: TA, Lim, dead Mart	0	2: TA, Mart around knot hole	2: TA, Lim	3: TA, Mart, Lim	2: etching, Lim, Mart
Ammoniacal copper arsenite	0.51	1: TA, Mart holes	2: TA, Lim, Mart 3: ML, Lim, Mart	4: TA to ML, Lim	2: TA, very slight etching, Lim, Mart	4: TA, etching, Lim, Mart	4: TA, Mart, Lim
Chromated copper arsenate, Type B Tributyltin oxide	0.50 0.13	0	0	5: TA, Lim	1: etching, Lim, Mart	1: TA, etching, Lim, Mart	4: TA, etching, Lim
Basic zinc sulfate Tributyltin oxide	2.66 <sup>b</sup> 0.09	0	0	0	0	0	1: very light etching, Lim

(continued)



Table 5. Continued

Treatment	Retention (lb/ft <sup>3</sup> )	Loss of Cross-Sectional Area (%) for					
		Piling No. 1	Piling No. 2	Piling No. 3	Piling No. 4	Piling No. 5	Piling No. 6
Ammoniacal copper arsenite Tributyltin oxide	0.51 0.11	0	2: ML, etching	1: TA, Lim	0	0	3: TA, Lim 1: ML
70-30 creosote-coal tar	31.7	3: TA, Lim	15: TA, Lim, Mart	0	0	4: TA, etching, Lim	1: TA, very light etching
Ammoniacal copper arsenite 70-30 creosote-coal tar	0.51 19.6	0	1: TA, very light etching	0	1: Lim	0	0
Copper sulfate Tributyltin oxide	0.06 <sup>a</sup> 0.19	18: TA, Lim, Mart	7: TA, Lim, Mart	7: TA, Lim, Mart 2: ML, Lim, Mart	3: TA, etching, Lim	2: etching, Lim, Mart	6: TA, Lim
Copper sulfate Tributyltin oxide	0.03 <sup>a</sup> 0.20	3: ML, Lim, Mart 7: TA, Lim, Mart	5: TA etching, Lim	3: TA, Lim	98: TA, 26-in.- long hole 2: ML, Lim	1: TA, etching, Lim	90: TA, 18 in. split 2: ML

<sup>a</sup> As metallic copper.<sup>b</sup> As metallic zinc.

Table 6. Summary of Inspection Results on Cooperative Piles at Pearl Harbor, Plus One Set of Piles Treated With Creosote by CEL (installed in 1963)<sup>a</sup>

Treatment (Number of Piles Redriven in May 1973)	Number of Piles Reported Attacked in --					
	1973	1974	1975	1976	1977	1978
Ammoniacal copper arsenite followed by creosote Douglas Fir (3)	0	0	0	0	0	1
Chromated copper arsenate Type A followed by creosote Douglas Fir (3) Southern Yellow Pine (3)	2 0	0 0	1 0	3 0	3 0	3 <sup>b</sup> 1
70-30 creosote-coal tar solution Douglas fir (3) Southern Yellow Pine (2)	1 2	0 0	0 0	0 2	0 2	2 2
70-30 creosote-coal tar solution containing 1% phenylmercuric oleate <sup>c</sup> Douglas fir (3) Southern Yellow Pine (1)	NR <sup>d</sup> NR	NR NR	0 0	2 0	2 0	2 1
70-30 creosote-coal tar solution containing 5% phenylmercuric oleate <sup>c</sup> Douglas Fir (1) Southern Yellow Pine (2)	NR NR	NR NR	0 1	0 1	1 1	1 2
70-30 creosote-coal tar solution followed by sheathing with cupro-nickel alloy Southern Yellow Pine (1)	NR	NR	0	0	0	0
CEL creosote Douglas Fir (5)	NR	3	1	3	4	5

<sup>a</sup>These piles were accidentally pulled in August 1972 and redriven in May 1973.

<sup>b</sup>One pile in this series was reported missing in the 1978 inspection.

<sup>c</sup>Nominal percentages. Analyses of core borings showed that the wood absorbed considerably less than the nominal percentage (Ref. 11).

<sup>d</sup>NR = not reported.

Table 7. Summary of Inspection Results on CEL- and Industry-Treated Piles at Pearl Harbor  
(installed in 1964)

Group <sup>a</sup>	Creosote Additive	Creosote Retentign (lb/ft <sup>3</sup> )	Additive Retentign (lb/ft <sup>3</sup> )	Number of Piles Reported Attacked in --							
				1971	1972	1973	1974	1975	1976	1977	1978
1	None	32.9	0	1	1	1	0	4	5	6	6
2	5% chlordan	28.6	1.4	0	2	1	0	1	0	2	2
3	2.5% chlordan	28.5	0.7	0	1	2	0	2	2	4	5
4	1.25% chlordan	26.3	0.3	0	2	0	0	3	2	3	4
5	30% copper naphthenate	8.3	0.27 <sup>b</sup>	0	2	1	0	2	4	4	6
6	15% copper naphthenate	9.4	0.15 <sup>b</sup>	2	3	3	0	4	4	5	5
7	7.5% copper naphthenate	10.9	0.09 <sup>b</sup>	1	2	2	1	3	5	5	5
8	14% copper naphthenate 1% tributyltin oxide	14.8	0.23 <sup>b</sup> 0.15	1	2	5	0	5	5	6	6
9	7% copper naphthenate 0.5% tributyltin oxide	8.6	0.07 <sup>b</sup> 0.08	0	2	2	0	4	4	6	6
10	None	18.6	0	0	1	4	3	4	4	4	4
11	2% tributyltin oxide	13.9	0.28	0	1	4	2	5	5	5	5
12	2% tributyltin oxide 2% dieldrin	17.4	0.35 0.35	0	0	0	0	0	0	0	1

<sup>a</sup>Treatment groups 1 through 9 had six Douglas fir piles each; groups 10, 11, and 12 had four, five, and six pine piles each, respectively.

<sup>b</sup>As metallic copper.



Table 8. Summary of Inspection Results on CEL-Treated Piles at Pearl Harbor (installed in 1965)<sup>a</sup>

Treatment <sup>b</sup>	Retention (lb/ft <sup>3</sup> )	Number of Piles Reported Attacked in --					
		1973	1974	1975	1976	1977	1978
4% copper oxinate	0.87 <sup>c</sup>	0	2	1	3	5	5
2% copper oxinate	0.49 <sup>c</sup>	4	2	2	3	5	5
2% copper oxinate 2% tributyltin oxide	0.25 <sup>c</sup> 0.25	4	0	0	4	6	6
3% copper oxinate 1% Victoria green base	0.69 <sup>c</sup> 0.26	3	2	1	2	4	5 <sup>d</sup>
5% chlordane 1% tributyltin oxide	1.3 0.27	0	2	0	0	2	3
5% chlordane 2% tributyltin oxide	1.5 0.62	0	2	1	1	1	2
1.5% copper oxinate 0.5% Victoria green base 50% creosote	0.27 <sup>c</sup> 0.09 9.2	6	4	4	6	6	6
0.75% copper oxinate 0.25% Victoria green base 75% creosote	0.25 <sup>c</sup> 0.08 24.7	4	4	1	3	3	4

<sup>a</sup>These piles were accidentally pulled in August 1972 and redriven in May 1973. Six piles in each group were redriven except where noted.

<sup>b</sup>Solution in xylene.

<sup>c</sup>As metallic copper.

<sup>d</sup>Five piles were redriven in May 1973.

Table 9. Summary of Inspection Results on CEL- and Industry-Treated Piles at Pearl Harbor (installed in 1966)

Treatment	Retentign (lb/ft <sup>3</sup> )	Number of Piles Reported Attacked in --							
		1971	1972	1973	1974	1975	1976	1977	1978
Chromated copper arsenate, Type B	0.50	3	3	3	5	4	6	6	6
Basic zinc sulfate	2.77 <sup>b</sup>	0	0	3	2	0	2	5	5
Ammoniacal copper arsenite	0.51	0	0	3	2	1	4	6	6
Chromated copper arsenate, Type B	0.50	0	0	0	2	1	2	3	4
Tributyltin oxide	0.13								
Basic zinc sulfate	2.66 <sup>b</sup>	0	0	0	1	0	0	1	1
Tributyltin oxide	0.09								
Ammoniacal copper arsenite	0.51	0	0	0	0	0	0	1	3
Tributyltin oxide	0.11								
70-30 creosote-coal tar	31.7	0	0	0	1	1	1	2	4
Ammoniacal copper arsenite	0.51	1	0	1	0	0	0	1	2
70-30 creosote-coal tar	19.6								
Copper sulfate	0.06 <sup>a</sup>	2	4	3	1	2	5	6	6
Tributyltin oxide	0.19								
Copper sulfate	0.03 <sup>a</sup>	0	1	0	2	3	5	6	6
Tributyltin oxide	0.20								

<sup>a</sup>As metallic copper.

<sup>b</sup>As metallic zinc.

## DISTRIBUTION LIST

AFB CESCH, Wright-Patterson; MAC/DET (Col. P. Thompson) Scott, IL; Stinfo Library, Offutt NE  
 ARMY BMDSC-RE (H. McClellan) Huntsville AL; DAEN-MCE-D Washington DC; HQ-DAEN-FEB-P (Mr. Price)  
 ARMY COASTAL ENGR RSCH CEN Fort Belvoir VA; R. Jachowski, Fort Belvoir VA  
 ARMY CORPS OF ENGINEERS MRD-Eng. Div., Omaha NE; Seattle Dist. Library, Seattle WA  
 ARMY ENG DIV HNDED-CS, Huntsville AL; Hnded-Sr, Huntsville, AL  
 ARMY ENG WATERWAYS EXP STA Library, Vicksburg MS  
 ARMY ENGR DIST. Library, Portland OR  
 ARMY ENVIRON. HYGIENE AGCY Water Qual Div (Doner), Aberdeen Prov Ground, MD  
 ARMY MATERIALS & MECHANICS RESEARCH CENTER Dr. Lenoe, Watertown MA  
 ARMY-PLASTEC Picatinny Arsenal (A M Anzalone, SMUPA-FR-M-D) Dover NJ  
 ASST SECRETARY OF THE NAVY Spec. Assist Energy (P. Waterman), Washington DC  
 BUREAU OF RECLAMATION Code 1512 (C. Selander) Denver CO  
 CINCLANT Civil Engr. Supp. Plans. Ofr Norfolk, VA  
 CINCPAC Fac Engrng Div (J44) Makalapa, HI  
 CNM NMAT 08T246 (Dieterle) Wash, DC  
 CNO Code NOP-964, Washington DC  
 COMFLEACT, OKINAWA Commander, Kadena Okinawa; PWO, Kadena, Okinawa  
 COMOCEANSYSPAC SCE, Pearl Harbor HI  
 DEFENSE DOCUMENTATION CTR Alexandria, VA  
 DOE Dr. Cohen  
 DTNSRDC Code 4121 (R. Rivers), Annapolis, MD  
 GSA Fed. Sup. Serv. (FMBP), Washington DC  
 KWAJALEIN MISRAN BMDSC-RKL-C  
 MARINE CORPS BASE Camp Pendleton CA 92055; Code 43-260, Camp Lejeune NC; M & R Division, Camp Lejeune  
 NC; PWO, Camp S. D. Butler, Kawasaki Japan  
 MARINE CORPS DIST 9, Code 043, Overland Park KS  
 MARINE CORPS HQS Code LFF-2, Washington DC  
 MCAS Facil. Engr. Div. Cherry Point NC; CO, Kaneohe Bay HI; Code PWE, Kaneohe Bay HI; Code S4, Quantico  
 VA; J. Taylor, Iwakuni Japan; PWD, Dir. Maint. Control Div., Iwakuni Japan; PWO Kaneohe Bay HI  
 MCRD PWO, San Diego Ca  
 NAF PWO, Atsugi Japan  
 NAS Asst C/S CE Corpus Christi, TX; CO, Guantanamo Bay Cuba; Code 114, Alameda CA; Code 183 (Fac. Plan BR  
 MGR); Code 18700, Brunswick ME; Code 18U (ENS P.J. Hickey), Corpus Christi TX; Code 8E, Patuxent Riv.,  
 MD; Dir. Maint. Control Div., Key West FL; Dir. Util. Div., Bermuda; ENS Buchholz, Pensacola, FL; PW (J.  
 Maguire), Corpus Christi TX; PWD Maint. Div., New Orleans, Belle Chasse LA; PWD, Maintenance Control Dir.,  
 Bermuda; PWO Belle Chasse, LA; PWO Key West FL; PWO, Dallas TX; PWO, Glenview IL; PWO., Moffett  
 Field CA; SCE Lant Fleet Norfolk, VA; SCE Norfolk, VA  
 NATL RESEARCH COUNCIL Naval Studies Board, Washington DC  
 NATPARACHUTETESTRAN PW Engr, El Centro CA  
 NAVACT PWO, London UK  
 NAVACTDET PWO, Holy Lock UK  
 NAVAEROSPREGMEDCEN SCE, Pensacola FL  
 NAVAL FACILITY PWO, Barbados; PWO, Cape Hatteras, Buxton NC; PWO, Centerville Bch, Ferndale CA  
 NAVCOASTSYSLAB Code 423 (D. Good), Panama City FL; Code 715 (J. Mittleman) Panama City, FL; Code 715 (J.  
 Quirk) Panama City, FL; Library Panama City, FL  
 NAVCOMMAREAMSTRSTA PWO, Norfolk VA; PWO, Wahiawa HI; SCE Unit 1 Naples Italy  
 NAVCOMMSTA Code 401 Nea Makri, Greece; PWO, Adak AK; PWO, Exmouth, Australia  
 NAVCONSTRACEN Code 74000 (Bodwell) Port Hueneme, CA  
 NAVEDTRAPRODEVNEN Tech. Library  
 NAVEDUTRACEN Engr Dept (Code 42) Newport, RI  
 NAVFAC PWO, Lewes DE  
 NAVFACENGCOM Code 043 Alexandria, VA; Code 044 Alexandria, VA; Code 0451 Alexandria, VA; Code 0453 (D.  
 Potter) Alexandria, VA; Code 0454B Alexandria, VA; Code 04B3 Alexandria, VA; Code 04B5 Alexandria, VA;  
 Code 101 Alexandria, VA; Code 1023 (M. Carr) Alexandria, VA; Code 1023 (T. Stevens) Alexandria, VA; Code 104  
 Alexandria, VA; Code 2014 (Mr. Taam), Pearl Harbor HI; Morrison Yap, Caroline Is.; PC-22 (E. Spencer)  
 Alexandria, VA; PL-2 Ponce P.R. Alexandria, VA



NAVFACENGCOM - CHES DIV. Code 101 Wash, DC; Code 405 Wash, DC; Contracts, ROICC, Annapolis MD  
 NAVFACENGCOM - LANT DIV.; Code 10A, Norfolk VA; Eur. BR Deputy Dir, Naples Italy; RDT&ELO 09P2, Norfolk VA  
 NAVFACENGCOM - NORTH DIV. AROICC, Brooklyn NY; Code 09P (LCDR A.J. Stewart); Code 1028, RDT&ELO, Philadelphia PA; Code 111 (Castranovo) Philadelphia, PA; Code 114 (A. Rhoads); Design Div. (R. Masino), Philadelphia PA; ROICC, Contracts, Crane IN  
 NAVFACENGCOM - PAC DIV. Code 09DG (Donovan), Pearl Harbor, HI; Code 402, RDT&E, Pearl Harbor HI; Commander, Pearl Harbor, HI  
 NAVFACENGCOM - SOUTH DIV. Code 90, RDT&ELO, Charleston SC; Dir., New Orleans LA  
 NAVFACENGCOM - WEST DIV. 102; Code 04B; RDT&ELO Code 2011 San Bruno, CA  
 NAVFACENGCOM CONTRACT AROICC, Point Mugu CA; Code 05, TRIDENT, Bremerton WA; Dir, Eng. Div., Exmouth, Australia; Eng Div dir, Southwest Pac, Manila, PI; OICC, Southwest Pac, Manila, PI; OICC/ROICC, Balboa Canal Zone; ROICC (Ervin) Puget Sound Naval Shipyard, Bremerton, WA; ROICC (LCDR J.G. Leech), Subic Bay, R.P.; ROICC LANT DIV., Norfolk VA; ROICC Off Point Mugu, CA; ROICC, Diego Garcia Island; ROICC, Keflavik, Iceland; ROICC, Pacific, San Bruno CA  
 NAVHOSP LT R. Elsbernd, Puerto Rico  
 NAVOCEANO Code 1600 Bay St. Louis, MS; Code 3432 (J. DePalma), Bay St. Louis MS  
 NAVOCEANSYSCE Code 52 (H. Talkington) San Diego CA; Code 6565 (Tech. Lib.), San Diego CA; Code 7511 (PWO) San Diego, CA  
 NAVPETOFF Code 30, Alexandria VA  
 NAVPHIBASE CO, ACB 2 Norfolk, VA; Code S3T, Norfolk VA; Harbor Clearance Unit Two, Little Creek, VA; OIC, UCT ONE Norfolk, Va  
 NAVREGMEDCEN PWO Newport RI; SCE (D. Kaye); SCE, Camp Pendleton CA  
 NAVSCOLCECOFF C35 Port Hueneme, CA; CO, Code C44A Port Hueneme, CA  
 NAVSEASYSCE Code OOC (LT R. MacDougal), Washington DC  
 NAVSHIPREPAC Library, Guam; SCE Subic Bay  
 NAVSHIPYD; CO Marine Barracks, Norfolk, Portsmouth VA; Code 202.4, Long Beach CA; Code 202.5 (Library) Puget Sound, Bremerton WA; Code 380, (Woodroff) Norfolk, Portsmouth, VA; Code 400, Puget Sound; Code 404 (LT J. Riccio), Norfolk, Portsmouth VA; Code 410, Mare Is., Vallejo CA; Code 440 Portsmouth NH; Code 440, Norfolk; Code 440, Puget Sound, Bremerton WA; Code 440.4, Charleston SC; Code 450, Charleston SC; L.D. Vivian; Library, Portsmouth NH; PWD (Code 400), Philadelphia PA; PWO, Mare Is.; PWO, Puget Sound; SCE, Pearl Harbor HI; Tech Library, Vallejo, CA  
 NAVSTA CO Naval Station, Mayport FL; CO Roosevelt Roads P.R. Puerto Rico; Engr. Dir., Rota Spain; Maint. Cont. Div., Guantanamo Bay Cuba; Maint. Div. Dir/Code 531, Rodman Canal Zone; PWD (LTJG.P.M. Motolenich), Puerto Rico; PWO Midway Island; PWO, Guantanamo Bay Cuba; PWO, Keflavik Iceland; PWO, Mayport FL; ROICC, Rota Spain; SCE, Guam; SCE, San Diego CA; SCE, Subic Bay, R.P.  
 NAVSUBASE LTJG D.W. Peck, Groton, CT; SCE, Pearl Harbor HI  
 NAVSUBSCOL LT J.A. Nelson Groton, CT  
 NAVSUPACT CO, Seattle WA; Code 413, Seattle WA; LTJG McGarrah, Vallejo CA  
 NAVSURFWPCEN PWO, White Oak, Silver Spring, MD  
 NAVTECHTRACEN SCE, Pensacola FL  
 NAVWPNCEN Code 2636 (W. Bonner), China Lake CA  
 NAVWPNSTA EARLE Code 092, Colts Neck NJ; ENS G.A. Lowry, Fallbrook CA; Maint. Control Dir., Yorktown VA; PW Office (Code 09C1) Yorktown, VA  
 NAVWPNSUPPCEN Code 09 Crane IN  
 NAVXDIVINGU LT A.M. Parisi, Panama City FL  
 NCBU 405 OIC, San Diego, CA  
 NCBC CEL AOIC Port Hueneme CA; Code 10 Davisville, RI; Code 156, Port Hueneme, CA; PWO (Code 80) Port Hueneme, CA; PWO, Davisville RI  
 NCR 20, Commander  
 NMCB 133 (ENS T.W. Nielsen); 5, Operations Dept.; Forty, CO; THREE, Operations Off.  
 NORDA Code 440 (Ocean Rsch Off) Bay St. Louis MS  
 NRL Code 8441 (R.A. Skop), Washington DC  
 NSC Code 54.1 (Wynne), Norfolk VA  
 NSD SCE, Subic Bay, R.P.  
 NTC Code 54 (ENS P. G. Jackel), Orlando FL  
 NUSC Code 131 New London, CT; Code EA123 (R.S. Munn), New London CT; Code TA131 (G. De la Cruz), New London CT  
 OCEANSYSLANT LT A.R. Giancola, Norfolk VA

ONR Code 700F Arlington VA; Dr. A. Laufer, Pasadena CA  
 PHIBCB 1 P&E, Coronado, CA  
 PMTC Pat. Counsel, Point Mugu CA  
 PWC CO Norfolk, VA; CO, Great Lakes IL; CO, Oakland CA; Code 120, Oakland CA; Code 120C (Library) San Diego, CA; Code 128, Guam; Code 200, Great Lakes IL; Code 200, Guam; Code 200, Oakland CA; Code 220 Oakland, CA; Code 220.1, Norfolk VA; Code 40 (C. Kolton) Pensacola, FL; Code 400, Pearl Harbor, HI; Code 505A (H. Wheeler); Code 680, San Diego CA; Library, Subic Bay, R.P.; OIC CBU-405, San Diego CA; Utilities Officer, Guam; XO Oakland, CA  
 SPCC Code 122B, Mechanicsburg, PA  
 UCT TWO OIC, Port Hueneme CA  
 U.S. MERCHANT MARINE ACADEMY Kings Point, NY (Reprint Custodian)  
 US DEPT OF AGRIC Forest Products Lab. (R. DeGroot), Madison WI  
 US GEOLOGICAL SURVEY Off. Marine Geology, Piteleki, Reston VA  
 USCG (G-ECV/61) (Burkhart) Washington, DC; G-EOE-4/61 (T. Dowd), Washington DC  
 USCG ACADEMY LT N. Stramandi, New London CT  
 USCG R&D CENTER Tech. Dir. Groton, CT  
 USNA Ocean Sys. Eng Dept (Dr. Monney) Annapolis, MD; PWD Engr. Div. (C. Bradford) Annapolis MD; PWO Annapolis MD  
 CALIF. DEPT OF NAVIGATION & OCEAN DEV. Sacramento, CA (G. Armstrong)  
 DAMES & MOORE LIBRARY LOS ANGELES, CA  
 DUKE UNIV MEDICAL CENTER B. Muga, Durham NC  
 FLORIDA ATLANTIC UNIVERSITY BOCA RATON, FL (MC ALLISTER); Boca Raton FL (Ocean Engr Dept., C. Lin)  
 FLORIDA ATLANTIC UNIVERSITY Boca Raton FL (W. Tessin)  
 INSTITUTE OF MARINE SCIENCES Morehead City NC (Director)  
 LEHIGH UNIVERSITY BETHLEHEM, PA (MARINE GEOTECHNICAL LAB., RICHARDS); Bethlehem PA (Linderman Lib. No.30, Flecksteiner)  
 LIBRARY OF CONGRESS WASHINGTON, DC (SCIENCES & TECH DIV)  
 MAINE MARITIME ACADEMY (Wyman) Castine ME; CASTINE, ME (LIBRARY)  
 MICHIGAN TECHNOLOGICAL UNIVERSITY Houghton, MI (Haas)  
 MIT Cambridge MA; Cambridge MA (Rm 10-500, Tech. Reports, Engr. Lib.)  
 NATL ACADEMY OF ENG. ALEXANDRIA, VA (SEARLE, JR.)  
 NY CITY COMMUNITY COLLEGE BROOKLYN, NY (LIBRARY)  
 OREGON STATE UNIVERSITY (CE Dept Grace) Corvallis, OR; Corvallis OR (School of Oceanography)  
 PURDUE UNIVERSITY Lafayette, IN (Altschaeffl); Lafayette, IN (CE Engr. Lib)  
 SOUTHWEST RSCH INST R. DeHart, San Antonio TX  
 STANFORD UNIVERSITY STANFORD, CA (DOUGLAS)  
 TEXAS A&M UNIVERSITY College Station TX (CE Dept. Herbich); W.B. Ledbetter College Station, TX  
 UNIVERSITY OF CALIFORNIA BERKELEY, CA (CE DEPT, GERWICK); Berkeley CA (B. Bresler); M. Duncan, Berkeley CA  
 UNIVERSITY OF DELAWARE Newark, DE (Dept of Civil Engineering, Chesson)  
 UNIVERSITY OF HAWAII HONOLULU, HI (SCIENCE AND TECH. DIV.)  
 UNIVERSITY OF ILLINOIS Metz Ref Rm. Urbana IL; URBANA, IL (DAVISSON); URBANA, IL (LIBRARY); URBANA, IL (NEWARK)  
 UNIVERSITY OF MASSACHUSETTS (Heronemus), Amherst MA CE Dept  
 UNIVERSITY OF MICHIGAN Ann Arbor MI (Richart)  
 UNIVERSITY OF NEBRASKA-LINCOLN Lincoln, NE (Ross Ice Shelf Proj.)  
 UNIVERSITY OF PENNSYLVANIA PHILADELPHIA, PA (SCHOOL OF ENGR & APPLIED SCIENCE, ROLL)  
 UNIVERSITY OF TEXAS Inst. Marine Sci (Library), Port Arkansas TX  
 UNIVERSITY OF TEXAS AT AUSTIN AUSTIN, TX (THOMPSON); Austin, TX (Breen)  
 UNIVERSITY OF WASHINGTON SEATTLE, WA (OCEAN ENG RSCH LAB, GRAY); Seattle WA (E. Linger)  
 UNIVERSITY OF WISCONSIN Milwaukee WI (Ctr of Great Lakes Studies)  
 URS RESEARCH CO. LIBRARY SAN MATEO, CA  
 VIRGINIA INST. OF MARINE SCI. Gloucester Point VA (Library)  
 ALFRED A. YEE & ASSOC. Honolulu HI  
 AMETEK Offshore Res. & Engr Div  
 ARVID GRANT OLYMPIA, WA  
 ATLANTIC RICHFIELD CO. DALLAS, TX (SMITH)  
 AUSTRALIA Dept. PW (A. Hicks), Melbourne

BECHTEL CORP. SAN FRANCISCO, CA (PHELPS)  
 BELGIUM HAECON, N.V., Gent  
 BETHLEHEM STEEL CO. Dismuke, Bethlehem, PA  
 BOUW KAMP INC Berkeley  
 BROWN & CALDWELL E M Saunders Walnut Creek, CA  
 BROWN & ROOT Houston TX (D. Ward)  
 CANADA Mem Univ Newfoundland (Chari), St Johns; Surveyor, Nenninger & Chenevert Inc., Montreal  
 DILLINGHAM PRECAST F. McHale, Honolulu HI  
 DRAVO CORP Pittsburgh PA (Giannino); Pittsburgh PA (Wright)  
 NORWAY DET NORSKE VERITAS (Library), Oslo  
 FRANCE Dr. Dutertre, Boulogne; L. Pliskin, Paris  
 GEOTECHNICAL ENGINEERS INC. Winchester, MA (Paulding)  
 GLIDDEN CO. STRONGSVILLE, OH (RSCH LIB)  
 HALEY & ALDRICH, INC. Cambridge MA (Aldrich, Jr.)  
 ITALY M. Caironi, Milan; Sergio Tattoni Milano; Torino (F. Levi)  
 KOREA Korea Rsch Inst. Ship & Ocean (B. Choi), Seoul  
 LAMONT-DOHERTY GEOLOGICAL OBSERV. Palisades NY (Selwyn)  
 LOCKHEED MISSILES & SPACE CO. INC. Mgr Naval Arch & Mar Eng Sunnyvale, CA; Sunnyvale CA  
 (Ryniewicz); Sunnyvale, CA (Phillips)  
 MARATHON OIL CO Houston TX (C. Seay)  
 MOBIL PIPE LINE CO. DALLAS, TX MGR OF ENGR (NOACK)  
 MUESER, RUTLEDGE, WENTWORTH AND JOHNSTON NEW YORK (RICHARDS)  
 NEW ZEALAND New Zealand Concrete Research Assoc. (Librarian), Porirua  
 NEWPORT NEWS SHIPBLDG & DRYDOCK CO. Newport News VA (Tech. Lib.)  
 NORWAY I. Foss, Oslo; J. Creed, Ski; Norwegian Tech Univ (Brandtzaeg), Trondheim  
 OCEAN RESOURCE ENG. INC. HOUSTON, TX (ANDERSON)  
 PACIFIC MARINE TECHNOLOGY Long Beach, CA (Wagner)  
 PORTLAND CEMENT ASSOC. SKOKIE, IL (CORELY); SKOKIE, IL (KLIEGER); Skokie IL (Rsch & Dev Lab,  
 Lib.)  
 PUERTO RICO Puerto Rico (Rsch Lib.), Mayaguez P R  
 RAYMOND INTERNATIONAL INC. E Colle Soil Tech Dept, Pennsauken, NJ  
 RIVERSIDE CEMENT CO Riverside CA (W. Smith)  
 SCHUPACK ASSOC SO. NORWALK, CT (SCHUPACK)  
 SEAFOOD LABORATORY MOREHEAD CITY, NC (LIBRARY)  
 SEATECH CORP. MIAMI, FL (PERONI)  
 SHELL OIL CO. HOUSTON, TX (MARSHALL); Houston TX (R. de Castongrene)  
 SOUTH AMERICA N. Nouel, Valencia, Venezuela  
 SWEDEN VBB (Library), Stockholm  
 TIDEWATER CONSTR. CO Norfolk VA (Fowler)  
 UNITED KINGDOM Cement & Concrete Assoc Wexham Springs, Slough Bucks; Cement & Concrete Assoc.  
 (Library), Wexham Springs, Slough; Cement & Concrete Assoc. (Lit. Ex), Bucks; D. Lee, London; D. New, G.  
 Maunsell & Partners, London; Taylor, Woodrow Constr (014P), Southall, Middlesex; Taylor, Woodrow Constr  
 (Stubbs), Southall, Middlesex  
 WATT BRIAN ASSOC INC. Houston, TX  
 WISS, JANNEY, ELSTNER, & ASSOC Northbrook, IL (D.W. Pfeifer)  
 WM CLAPP LABS - BATTELLE DUXBURY, MA (LIBRARY); Duxbury, MA (Richards)  
 WOODWARD-CLYDE CONSULTANTS PLYMOUTH MEETING PA (CROSS, III)  
 ADAMS, CAPT (RET) Irvine, CA  
 ANTON TEDESKO Bronxville NY  
 BRAHTZ La Jolla, CA  
 BULLOCK La Canada  
 R.F. BESIER Old Saybrook CT  
 R.Q. PALMER Kaitua, HI  
 SMITH Gulfport, MS  
 T.W. MERMEL Washington DC



END

DATE  
FILMED

5-79

AD-A066 225

CIVIL ENGINEERING LAB (NAVY) PORT HUENEME CALIF  
1978 INSPECTION OF EXPERIMENTAL MARINE PILING AT PEARL HARBOR, --ETC(U)  
DEC 78 T ROE

F/G 13/10

UNCLASSIFIED

CEL-TN-1538

NL

2 OF 2  
AD  
A066225

SUPPLEMENTARY  
INFORMATION



END  
DATE  
FILMED  
9-79  
DDC

**SUPPLEMENTARY**

**INFORMATION**





CIVIL ENGINEERING LABORATORY  
NAVAL CONSTRUCTION BATTALION CENTER  
PORT HUENEME, CA 93043

IN REPLY REFER TO

L08/PDT/jw  
DNL Z-R000-147  
DNL Z-R000-01-147  
Serial 278  
21 February 1979

From: Officer in Charge  
To: Distribution

Subj: Errata Sheet for Technical Note N-1505, "1977 Inspection of Experimental Marine Piling at Pearl Harbor, Hawaii," by Thorndyke Roe Jr.; and for Technical Note N-1538, "1978 Inspection of Experimental Marine Piling at Pearl Harbor, Hawaii," by Thorndyke Roe, Jr.

1. Please make the following pen and ink corrections:

~~N-1505, Page 6: 2nd column, 1st entry should be JHB vice AZLS~~

~~Page 7: 3rd column, 1st entry should be 0.9 vice 6.9~~

AD-A066225 N-1538, Page 6: 2nd column, 2nd entry should be JHB vice AZLS  
Page 7: 3rd column, 1st entry should be 0.9 vice 6.9

  
PETER D. TRIEM  
By direction